


Příklad značení :

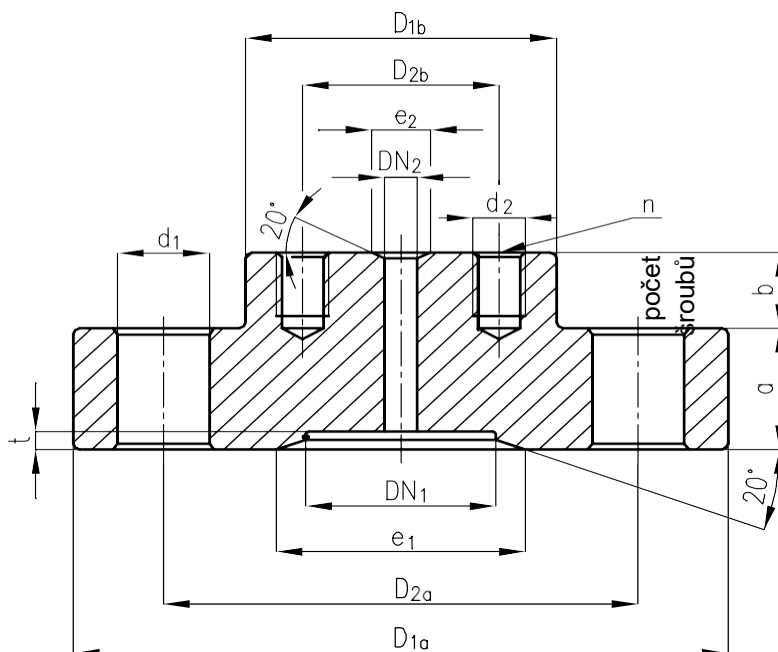

Přechod přírubový DN58/DN10 z oceli 12020 podle N16.81

| Jmenovitá světlost | Rozměry příruby | | | | | | | | Jmenovitá světlost | Rozměry přechodu | | | | | SN1681.xx Materiál | | Hmotnost 1ks v kg |
|--------------------|-----------------|-----------------|-----------------|----------------|----------------|-------------------------|----|----|--------------------|------------------|-----------------|-----------------|-----------------|----------------|--------------------|------|-------------------|
| | DN ₁ | D _{1a} | D _{2a} | e ₁ | d ₁ | šrouby počet x velikost | a | t | | b | DN ₂ | D _{1b} | D _{2b} | e ₂ | d ₂ | n | |
| 58 | 200 | 145 | 76 | 28 | 6x1" | 40 | 6 | 25 | 10 | 95 | 60 | 18 | W5/8" | 3 | .2 | .26 | 9,8 |
| 70 | 225 | 170 | 92 | 32 | 6x11/8" | 50 | 6 | 25 | 10 | 95 | 60 | 18 | W5/8" | 3 | .4 | .28 | 14,8 |
| 90 | 260 | 195 | 116 | 35 | 6x11/4" | 55 | 7 | 25 | 10 | 95 | 60 | 18 | W5/8" | 3 | .7 | .31 | 21,8 |
| 120 | 330 | 255 | 152 | 42 | 8x11/2" | 70 | 8 | 25 | 16 | 105 | 68 | 26 | W5/8" | 3 | .11 | .35 | 41,7 |
| | | | | | | | | 30 | 30 | 135 | 95 | 43 | W3/4" | 4 | | .360 | 43,0 |
| | | | | | | | | 35 | 45 | 165 | 115 | 60 | W7/8" | 6 | | .361 | 44,7 |
| 160 | 400 | 315 | 202 | 48 | 8x13/4" | 95 | 9 | 25 | 16 | 105 | 68 | 26 | W5/8" | 3 | .15 | .39 | 83,0 |
| | | | | | | | | 30 | 30 | 135 | 95 | 43 | W3/4" | 4 | .81 | .83 | 84,1 |
| | | | | | | | | 35 | 45 | 165 | 115 | 60 | W7/8" | 6 | .82 | .84 | 85,7 |
| 200 | 480 | 380 | 250 | 55 | 8x2" | 130 | 12 | 30 | 30 | 135 | 95 | 43 | W3/4" | 4 | .21 | | 164,7 |
| | | | | | | | | 35 | 45 | 165 | 115 | 60 | W7/8" | 6 | .22 | .46 | 166,1 |

| | | |
|--|--|---|
| Nahrazuje : N 16.81 z 10/1970 | Správce normy : Sekce podpory údržby | Platnost od : 1.1.2001 (Aktuálnost ověřena 2.2.2022) |
|--|--|---|